

QUICK INSTALLATION GUIDE

TEMP/HUMIDITY/CO2 DEVICE WITH OPTIONAL SOUND MEASUREMENT (-S) AND INDICATION (-I)
(LAN-WMBUS-E2-CO2-(S)-(I))




Recommended mounting instructions:

- Always mount on an interior wall, e.g., hallway
- The sensor works best 180cm above floor
- Mount the device so the holes at the front is on the right side
- Make sure that the UP symbol on the label (located on the side) is pointing upwards
- Avoid heating/cooling sources (solar radiation, lamps, pipes, extensive airflow, etc.)
- Mount the device with screws

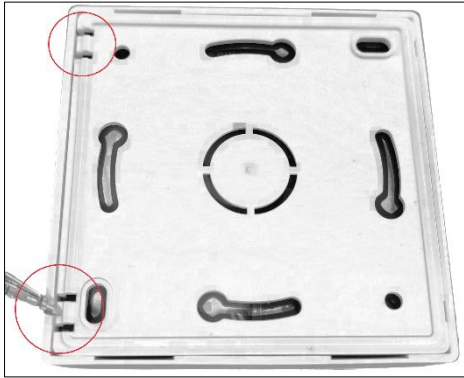

Step 1:

Turn the device upside down.
Remove the mounting piece by pushing the two plastic pieces, marked by red circles, inwards and then lifting the piece up.

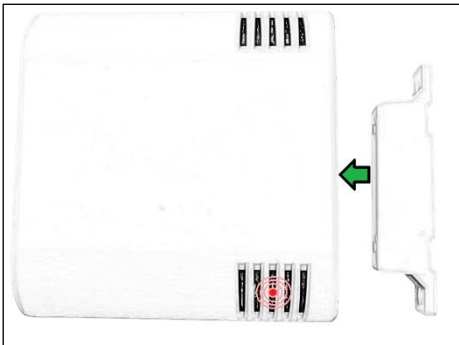


Step 2 (activate device):

Hold a permanent magnet against the label on device - A red LED will turn on and a short beep will be heard.

Keep holding the magnet until the LED turns off (after about 5 seconds) and another short beep is heard.

Note: Upon successful activation, a green LED will flash and the device will beep for a couple of seconds.

Note: If magnet is held for less than 5 seconds, the device will send out one packet and go back to sleep. After 25 seconds, it is possible to retry activation.

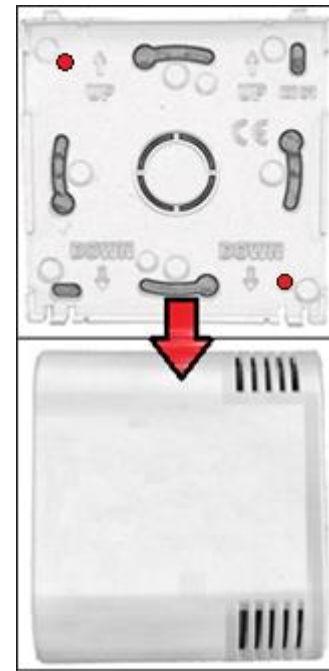

Step 3a:

Fasten the mounting piece to a wall with the text UP pointing upwards using the recommended mounting instructions.
Use two screws in the two holes filled with red in the picture.

Step 3b:

Mount the device on the mounting piece. Make sure the UP symbol on the label at the side of the device is pointing upwards.

Note: The ventilation slits must be on the right side.

The installation is now complete!